

September 12th 2019

Installation Advisory IA E-04.6

**Affects: Model E-04 Remote Control and Audio Alert battery
Model E-04C Remote Control and Audio Alert battery**

Because of the many quality control problems, we have seen recently with Duracell batteries leaking we no longer recommend using Duracell batteries in the Audio Alert (P/N E-04.7) or the Remote Control Panel Indicator (P/N E-04.5/E-04.5.1).

Battery leakage in the Remote or Audio Alert can cause inadvertent activation of the ELT, or constant dim blinking of the remote LED which will cause the remote battery to discharge.

Following is a list of recommended alternate batteries for the Remote Control Panel Indicator. The use of other manufacturers equivalent batteries is acceptable.

Lithium 10 year replacement interval.

Manufacturer Part number

Varta V28PXL

Dantona LITH-17

Excell L544

Alkaline 5 year replacement interval.

Manufacturer Part number

Eveready A544

Energizer A544

Silver Oxide 7 year replacement interval.

Manufacturer Part number

Exell S28PX

Vinnic S1325

Following is a list of recommended Lithium batteries for the E-04 and E-04C Audio Alert and E-04C Remote. Lithium 10 year replacement interval.

Manufacturer Part number

Panasonic CR2

Energizer CR2

Varta CR2